
Thermometer Dimensions Rear View Side View Sapphire Window **(** 73.3/2.9 Power/Comms LED Laser switch Multipin thermometer connecto 38.5/1.5 90.8/3.60 Mounting slot 45.8/1.8 308001

SN-W/E Interface Unit Dimensions

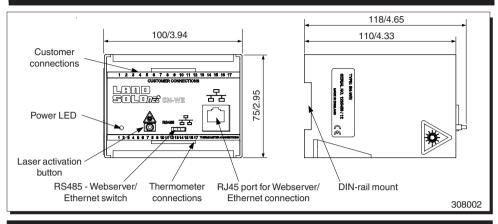

SN-W/E Interface Unit and Thermometer Plug Wiring Details

| | SN-W/E | ' | | | Thermometer | |
|-----|-----------------------|-------------|----------|-----|--------------------|-------|
| Cu | ıstomer | Thermometer | | | | |
| Con | nections | Connections | | | | |
| Pin | Description | Pin | Connects | Pin | Description | Cable |
| No. | | No. | to | No. | • | No. |
| 1 | 24V | 1 | ←── | Α | Power in+ | 1 |
| 2 | 0V | 2 | ←── | В | Power in- | 2 |
| 3 | mA out+ from IRT | 3 | ←── | С | mA out+ | 3 |
| 4 | mA out- from IRT | 4 | ← | Ν | mA out- | 4 |
| 5 | Emissivity in+ to IRT | 5 | ← | F | Emissivity in+ | 5 |
| 6 | Emissivity in- to IRT | 6 | ← | Е | Emissivity in- | 6 |
| 7 | Laser switch | 7 | ← | D | Laser in | 7 |
| 8 | Common | 8 | ← | L | Common | 8 |
| 9 | Command switch | 9 | ← | M | Command in | 9 |
| 10 | Relay 1a | 10 | ← | 0 | Relay 1a o/p | 10 |
| 11 | Relay 1b | 11 | ← | Р | Relay 1b o/p | 11 |
| 12 | Relay 2a | 12 | ← | R | Relay 2a o/p | 12 |
| 13 | Relay 2b | 13 | ← | S | Relay 2b o/p | 13 |
| 14 | Comms from IRT+ (A) | | ← | K | IRT comms out+ (Y) | 14 |
| 15 | Comms from IRT- (B) | 15 | ← | 1 | IRT comms out- (Z) | 15 |
| 16 | Comms to IRT- (Z) | 16 | ← | Н | IRT comms in- (B) | 16 |
| 17 | Comms to IRT+ (Y) | 17 | ←── | G | IRT comms in+ (A) | 17 |

- The connector pin column can be used if the prewired cable supplied by Land is not used.
- Common is used for the laser and command if an external switch is used
- Comms input/output change over between the SN-WE and thermometer

| Model | SN11 | SN21 | SN51 | SNR1 |
|-----------------------------|--|--|--|-------------------------------------|
| Operating range: | 550 to 1750°C/ 1022 to 3182°F | 250 to 1300°C/ 482 to 2372°F | 200 to 1100°C/ 392 to 2012°F | 700 to 1750°C/ 1292 to 3182°F |
| Specified range: | 600 to 1750°C/ 1112 to 3182°F | 300 to 1300°C/ 572 to 2372°F | 250 to 1100°C/ 482 to 2012°F | 750 to 1750°C/ 1382 to 3182°F |
| Spectral response: | 1µm | 1.6µm | 2µm | 1µm ratio |
| Field of view (95% energy): | 100:1 | 100:1 | 50:1 | 100:1 |
| Focusing: | Fixed, user con | Fixed, user configurable focus: 250mm/9.8in, 500mm/19.7in, 1000mm/39.4in and infinity | , 500mm/19.7in, 1000mm/39 | 9.4in and infinity |
| Output: | | 0 or 4 to 20mA user selectable (isolated 50V) | ectable (isolated 50V) | |
| Response time (0 to 90%): | 10ms | 10ms | 50ms | 10ms |
| Emissivity: | | 0.10 to 1.00 | 0 | 1 |
| Non greyness: | | 0.80 to 1.25 | 2 | |
| Resolution (mid range): | | ×1.× | | |
| Stability: | 0.2°/° | 0.2°/° | 0.02%K/K | 0.05K/K |
| Accuracy (absolute): | 0.3%K | 2K | 0.35%K | 0.6%K |
| Time functions: | | Peak picker, track and hold, and averager | old, and averager | |
| Alarm outputs: | Process high, process lov rated | Process high, process low, internal temperature, emissivity/NG signal lost, insufficient signal (SNR1only); rated to 50V d.c., 0.1A non-inductive, NO or NC – software selectable | vity/NG signal lost, insufficier e, NO or NC – software selec | nt signal (SNR1only); ctable |
| Optional sighting: | Laser defining o | Laser defining optical axis; class 2, 1mW, 650nm, 120s ON duration, automatic switch-off | onm, 120s ON duration, autor | matic switch-off |
| Ambient limits: | 5 to 6 | 5 to 60°C/41 to 140°F specified; 0 to 70°C/32 to 158°F operating | to 70°C/32 to 158°F operating | Di . |
| EMC: | | EN 61326:1999 (immunity and emission) | ity and emission) | |
| Sealing: | | IP65/NEMA 4X | 4X | |
| Vibration: | | 3g (10 to 300Hz) | Hz) | |
| Power supply: | | 18 to 30V d.c. (24V d.c. nominal) | nominal) | |
| Optional accessories: | Air cooled/purge 1-axis and 2-ax Web/Ethernet In | Air cooled/purged jacket, water cooled/air purged jacket, air purge and mounting bracket, 1-axis and 2-axis adjustable mounting brackets, 3m, 15m, 25m prewired cable assemblies, Wab/Fthernet practage I lait SN.W/F of power supply unit temperature indicator unit 1 Mi | ged jacket, air purge and mouts, 3m, 15m, 25m prewired cannot sunply unit temperature is | unting bracket, able assemblies, |
| | *************************************** | ויכוומספ כווווי כוז זיי, ייכי אכז | الانتخابية بدينه بعريه | ומוסמוסו מוווג דיאוו |

General Information

This guide gives the basic information required to install a Land SOLOnet Digital Infrared Thermometer. For more detailed information, see the SOLOnet User Guide (PP307).

It is important to fully check the equipment with which you have been supplied to ensure that all ordered items, including accessories, have been delivered.



If the thermometer is to be used in an area of ambient temperature higher than that specified, then the thermometer must be housed in a protective cooling jacket, available from Land Instruments International.

If the thermometer is to be used in an area where the atmosphere contains a high proportion of dust/smoke/steam etc, then the thermometer must be used in conjunction with an air purge system, to keep the thermometer lens clean and free from contamination. An air purge system is available from Land Instruments International.

Laser Safety Warnings



Warning

CLASS 2 Laser Product.

DO NOT stare into laser beam (1.0mW maximum output at 650nm).

DO NOT look directly towards the thermometer window, or into the laser beam during operation.

If the laser is projected onto a highly reflective surface, DO NOT look at the laser stripe from a position where a direct ('mirror-like') reflection may enter the eye.



Warning

CLASS 2 Laser Product.

DO NOT attempt to disassemble the laser unit or any of it's mounting components.



Caution

Caution - use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.

Land Instruments International **Infrared Temperature Measurement**

Dronfield S18 1DJ, England Telephone: (Ø1246) 417691 Facsimile: (Ø1246) 41Ø585 Email:infrared.sales@landinst.com Internet: www.landinst.com

Land Instruments Sarl Infrared Temperature Measurement

7 Parc des Fontenelles 7887Ø Bailly, France Téléphone: (1) 34 62 Ø5 45 Télécopie: (1) 3Ø 56 51 12 Email: commercial@landinst.fr Internet: www.landinst.fr

Land Instruments GmbH Infrared Temperature Measurement

Fixheider Str. 6 51381 Leverkusen, Germany Telefon: Ø2171/7673-Ø Telefax: Ø2171 /7673-9 Email: infrarot@landinst.de Internet: www.landinst.de

Land Instruments Sri **Infrared Temperature Measurement**

Via dell'Industria, 2 20037 Paderno Dugnano, Milano, Italy Telefono: Ø2/99Ø4Ø423 Telefax: Ø2/99Ø4Ø418 Email: info@landinst.it Internet: www.landinst.it

31-27 Toyotsuchou, Suita Osaka 564-ØØ51, Japan Telephone: Ø6 633Ø 5153 Facsimile: 06 6330 5338 Email: info@landinst.jp Internet: www.landinst.jp

Land Instruments International

Av. Horacio 1132 Planta Baja "B" Col. Polanco 1155Ø Mexico, D.F. Telephone: 52 55 5281 1165 Facsimilie: 52 55 5281 5364 Email: ventas@landinstruments.net Internet: www.landinstruments.net

Land Instruments International **Infrared Temperature Measurement**

Chile, 10-Edificio Madrid 92 2829Ø Las Matas, Madrid, Spain Telephone: 91 630 0791 Facsimile: 91 63Ø 2918 Email: land-infrared@landinst.es

Land Instruments International Infrared Temperature Measurement

10 Friends Lane Newtown, PA 18940-1804, USA Telephone: (215) 5Ø4-8ØØØ Facsimile: (215) 5Ø4-Ø879 Email: irsales@landinstruments.net Internet: www.landinstruments.net



Digital Infrared Thermometer

Installation Guide



www.landinst.com



instruments international







Part No. 801349 Publication N°. PP3Ø8 - Issue: P Ø7/Ø5 © Land Instruments International, 2005

LABORATORY

Recommended Installation Arrangement

The location of the SOLOnet thermometer should be carefully chosen, such that it is easily accessible and in a position not unnecessarily exposed to heat, fumes or liquid spray. The sight path between the SOLOnet thermometer and the target, should be as free as possible from smoke, liquid spray and from the intrusion of machinery. The axis of the thermometer should be at right angles to the target surface, however, an angle of up to 45° from the normal is acceptable. If the thermometer to be installed is a monochromatic or single wavelength variant (SN1 etc), it must be positioned such that at the chosen target distance, the field of view of the thermometer is completely filled. The target size required to fill the field of view can easily be determined, according to the lens configuration and the distance of the thermometer from the target (see 'SOLOnet Thermometer Sighting').

SOLOnet Thermometer Installation


- Choose a suitable location for mounting the thermometer. The following criteria should be considered when making the choice:
 - If the installation area is not clean or free from dust, smoke or water spray, then a Land air purge system <u>must</u> be utilised to ensure that the thermometer lens is kept free from such airborne contaminants. Ensure that a suitably conditioned air supply is available.
 - If the surrounding ambient temperatures of the installation area are outside the thermometer specification, then a Land air or water cooled protective jacket <u>must</u> be utilised to ensure that the thermometer operates at the specified ambient temperature. Ensure that a suitably conditioned air or water supply is available.
- 2. Position and mount any required thermometer mountings and/or accessories (see SOLOnet Mountings and Accessories Installation Guide PP310).
- 3. Configure the thermometer lens and spacers to match the application (see 'Thermometer Sighting'). Ensure that the selected ring configuration allows correct focusing of the thermometer onto the target.
- 4. Configure the thermometer to match the application (see SOLOnet Quick Start Guide PP305).
- 5. Fit the thermometer to the mountings. Ensure that the services, where required, are running and are fully operational before installing an unprotected thermometer into a hostile environment. Ensure that the thermometer lens is clean, free from contaminants and unobstructed.
- 6. Apply power to the thermometer. If the thermometer has a laser alignment facility, this can be utilised to ensure that the thermometer field of view aligns with the target area. The laser function can be operated by the following methods:
 - By the laser activation button on the rear of the thermometer
 - By the laser activation button on the front of the SN-W/E interface unit
 - From within the configuration software or web interface
 - By remote manual switch, wired into the SN-W/E interface unit (user supplied)
- 7. Ensure that the thermometer is operating correctly. Any configuration changes can be made via the configuration software or web interface facility.
- 8. Carry out the following recommended pre-operational checks:
 - Ensure that all relevant services are functioning correctly, with no apparent air or water leaks.
 - Ensure that the thermometer lens is clean, free from contaminants and unobstructed.
 - Ensure that all piping and cables are safely stowed, as determined by local safety procedures.
 - Ensure that any instrument cables are routed clear of any "noisy" cables. This is generally considered good practice, helping to avoid electrical interference.
- 9. It is recommended that a local maintenance procedure should be determined, with particular attention to thermometer lens cleanliness and services integrity.

SOLOnet Thermometer lens configuration


The location of the lens of the SOLOnet thermometer can be manually configured within the thermometer housing. This allows selection of focal length to suit the diverse range of possible SOLOnet applications. The following information details the lens and spacer configuration method:

It is highly recommended that the following procedure is carried out in a clean and dry environment, eliminating the chance of thermometer contamination.

- 1. Unscrew, remove and retain the 4xM2.5 retaining screws (1) from the thermometer window holder (2).
- 2. Remove the window holder with sapphire window (3) and environmental seal (4).
- 3. Remove the three coloured spacers; red (5), blue (6), yellow (7) and the black lens housing with lens (8). Ensure that the lens is not marked during this procedure.
- 4. Configure the thermometer lens and spacers to match the application (see 'Thermometer Sighting').
- 5. Place the spacers and lens into the housing in the relevant order, ensuring that the black lens is placed with the marker line facing towards the window.
- 6. Check that the environmental seal is intact and refit to the thermometer housing.
- 7. Ensure that the sapphire window is clean and smear free. Place the window housing with sapphire window and position in the thermometer window recess, ensuring that the seal is not trapped anywhere.
- 8. Refit and tighten the 4x window housing retaining screws.
- 9. Ensure that the sapphire window is clean and smear free.

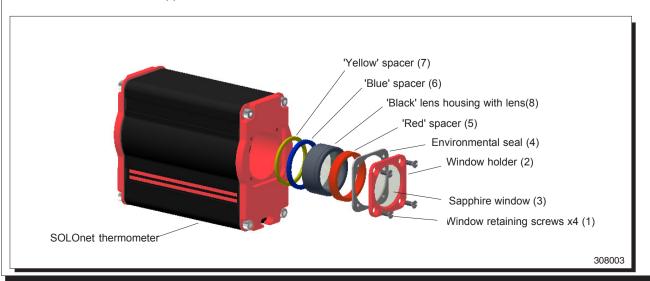

SOLOnet Thermometer Sighting SOLOnet SN1, SN2 and SNR Focus at 250mm/9.8in 18 2.5 23 146 228 Spot size mm 0 250 500 Distance 3000 0.7 0.1 Spot size inches 118.2 Distance Focus at 500mm/19.7in 110 Distance 1000 2000 3000 Spot size inches 118.2 Distance Focus at 1000mm/39.4in Spot size 74 mm 1000 2000 Distance 3000 Spot size inches 19.7 39.4 78.8 118.2 Distance Focus at Infinity Spot size mm Distance 3000 Spot size 0.59 1.77 inches Distance 118.2 SOLOnet SN5

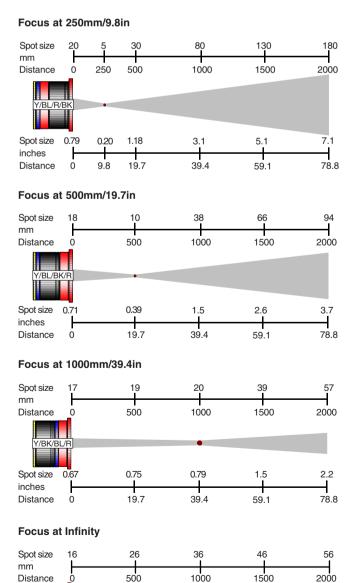

1.02

19.7

Spot size

inches

22

78.8

308004

59.1